


The specified erosion and sediment control standards are the general guidelines and shall not limit the right of the county to impose, at any time, additional, more stringent requirements. Nor shall the standards limit the right of the county to waive, in writing, individual requirements.



Note: other approved seed species may be substituted.

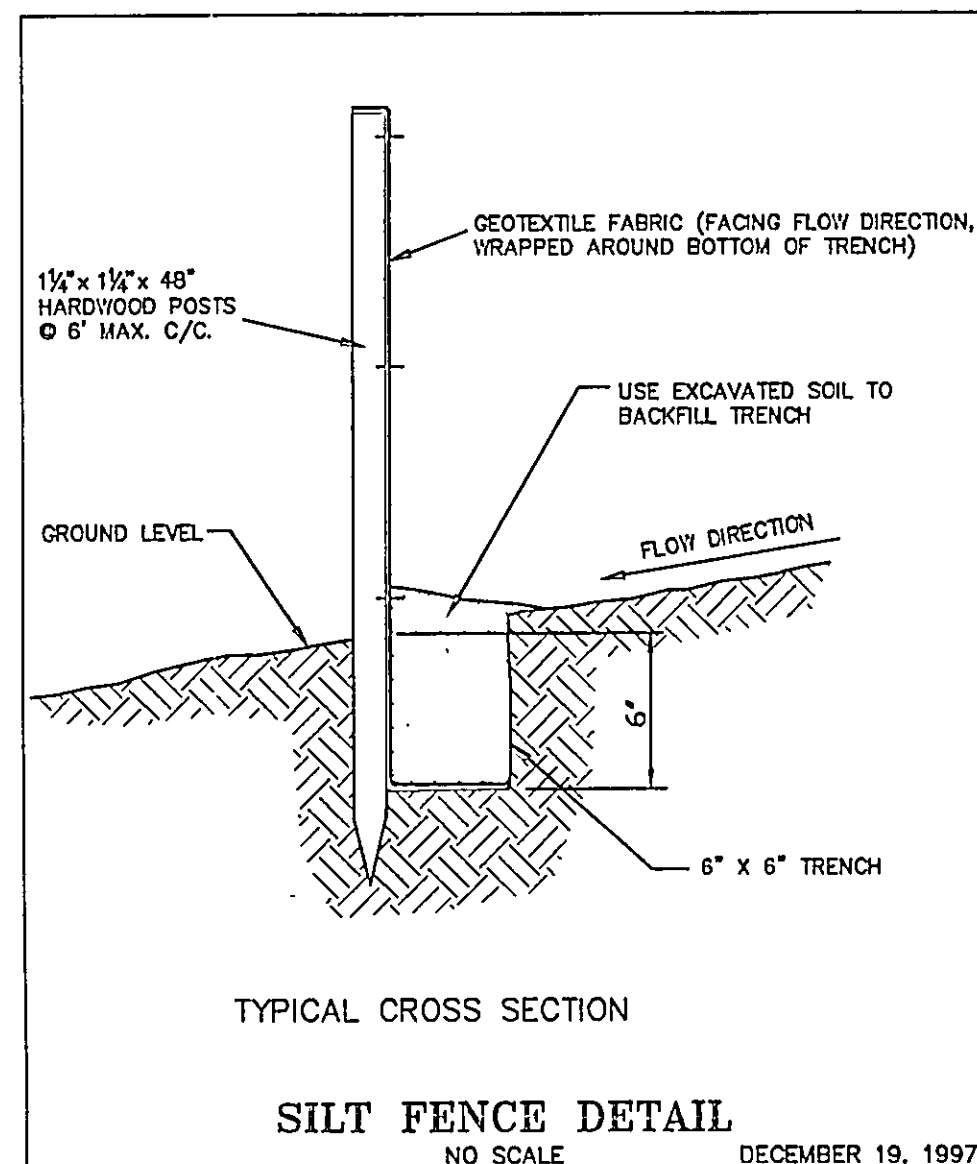

\*\* SEEDING DISTILLED FROM MAY 15 - AUG. 15 WILL REQUIRE ADDITIONAL WATERING TO PROMOTE SEED GROWTH. MULCH MAY ALSO BE USED TO HOLD MOISTURE.

[illegible]

\STORM &amp; EROSION DETAILS\EROSION CONTROL TIMETABLE

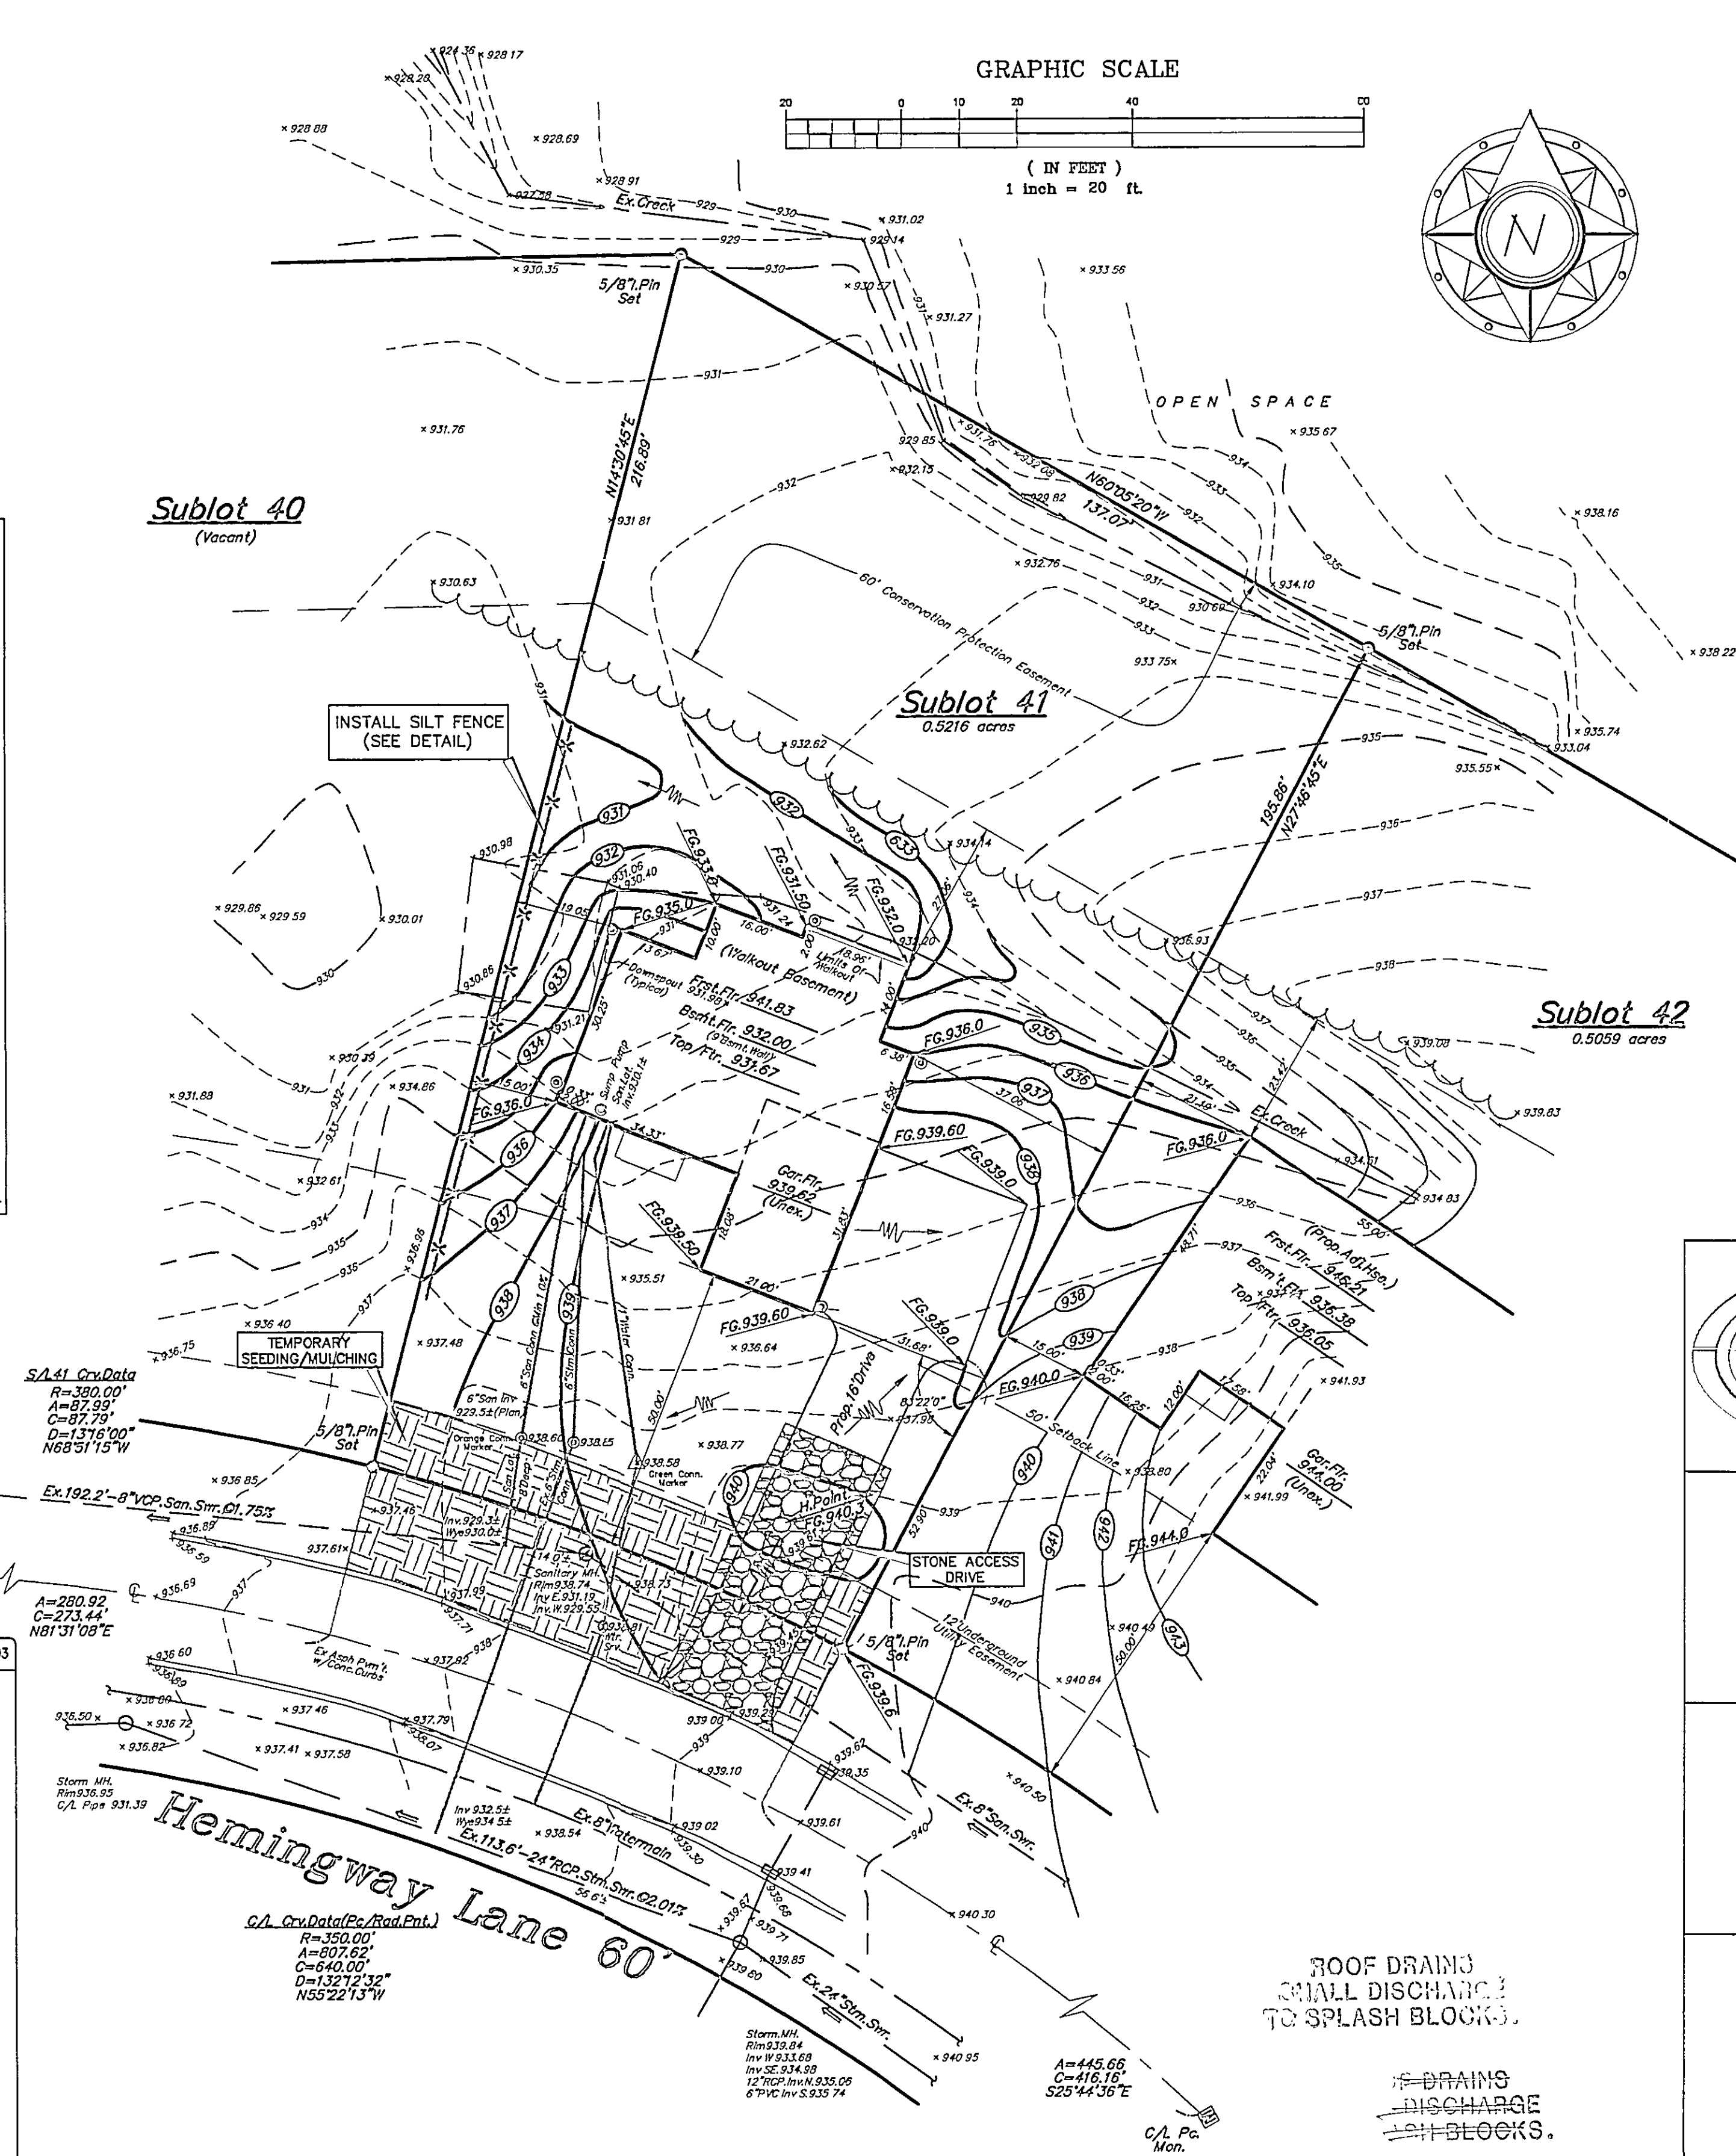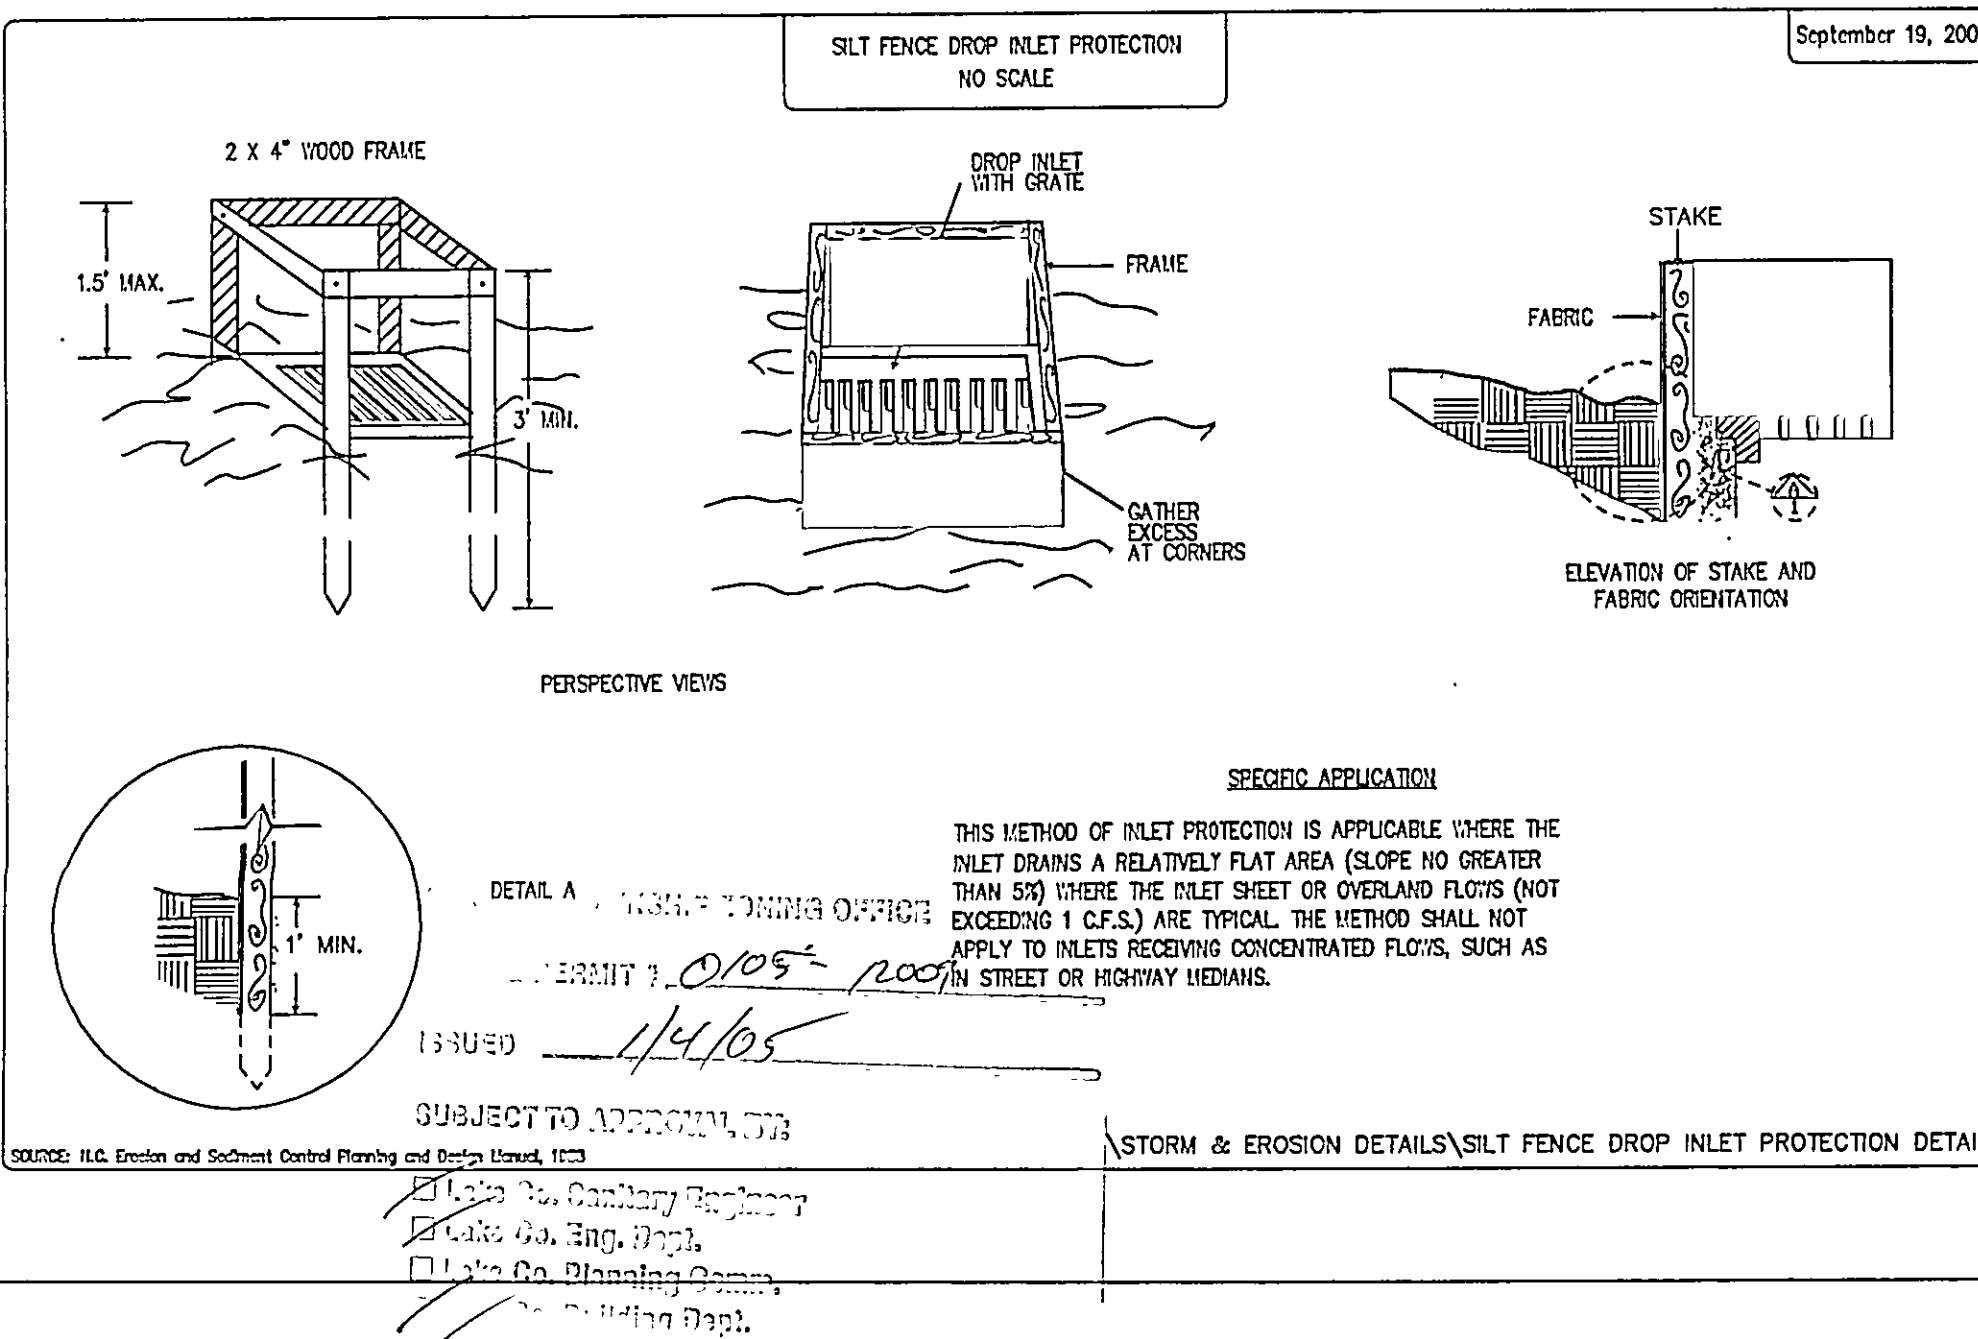

ESTIMATED IMPERVIOUS AREA  
HOUSE: 0.06Ac.  
DRIVE: 0.05Ac.  
TOTAL: 0.11Ac.

**Housa Summary**  
Model#2962, Et.#2  
3-Car Side Entry, Right Hand Gar.  
With Walkout Bsm't., Sunroom  
And 4' Family Extension.  
Str.Add.#2623 Hemmingway Lane  
-See Architect Plans For  
Complete House Dimensions.  
-Utility Connections Per Plan;  
Contractor To Verify Location  
And Depth Of All Laterals.


NOTE: HOUSE DOWNSPOUTS ALONG THE FRONT AND RIGHT SIDE OF THE HOUSE TO BE TIED INTO EXISTING STORM SYSTEM. HOUSE DOWNSPOUTS ALONG THE REAR OF THE HOUSE SHALL BE OUTLETTED TO SPLASHBLOCKS.

-FINAL LOCATION OF DOWNSPOUTS  
TO BE VERIFIED WITH ARCHITECTURAL  
PLANS.

I, THE UNDERSIGNED, HEREBY CERTIFY THAT THIS TOPOGRAPHY, INDICATED BY 6", 1', OR 2' CONTOURS, AND ELEVATIONS SHOWN HEREON, REPRESENT AN ACTUAL FIELD SURVEY MADE BY ME ON THE 30th DAY OF JULY, 2004, AND THAT THE ELEVATIONS WERE TAKEN AT APPROPRIATE INTERVALS AND THAT AS OF THAT DATE, THEY EXISTED AS INDICATED HEREON.

Dustin R. Keeney  
Dustin R. Keeney, P.E.65515

Site &amp; Grade Hse., 12-10-04 G.S.V.

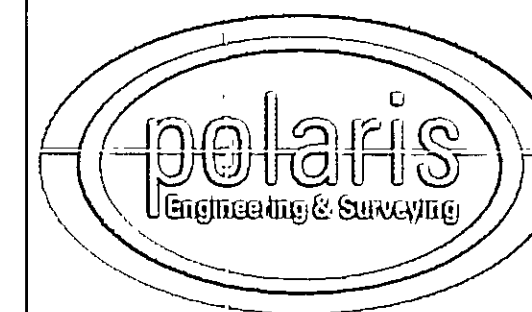


POLARIS ENGINEERING & SURVEYING, INC.  
34600 CHARDON ROAD - SUITE D  
WILLOUGHBY HILLS, OHIO 44094  
(440) 944-4433 (440) 944-3722 (Fax)  
[www.polaris-es.com](http://www.polaris-es.com)

THIS PLAN WAS PREPARED BY ME, AND IS CORRECT TO THE BEST OF MY KNOWLEDGE AND BELIEF.

NAME \_\_\_\_\_ DATE \_\_\_\_\_

B.M. = T.B.M Set On Top Of Hydrant  
 Located Opposite S/L 44  
 Elevation 948.54

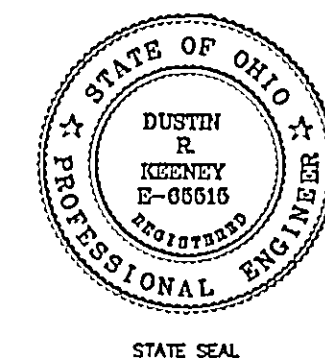

I HEREBY CERTIFY THAT THE CIRCLED INFORMATION IS EXISTING AS OBTAINED ON THE SITE \_\_\_\_\_ AND IS CORRECT TO THE BEST OF MY KNOWLEDGE AND BELIEF.

NAME \_\_\_\_\_ DATE \_\_\_\_\_

SUBLOT 41  
Holden Ridge Ph.2  
(WELLESLEY CHASE SUBDIVISION)  
Concord Twp., Lake County, Ohio

CONTRACT No.  
04568  
DATE: 12/10/04  
SCALE: HOR. 1"=20'  
VERT. 1"=20'  
FILENAME: sublet41.dwg

**EXISTING UNDERGROUND UTILITIES NOTE:**  
THE SIZE AND LOCATION, BOTH HORIZONTAL AND VERTICAL  
OF THE UNDERGROUND UTILITIES SHOWN HEREON, HAVE BEEN  
OBTAINED BY A SEARCH OF AVAILABLE RECORDS. VERIFICATION  
BY FIELD OBSERVATION HAS BEEN CONDUCTED WHERE PRACTICAL.  
HOWEVER, POLARIS ENGINEERING & SURVEYING, INC. DOES NOT  
GUARANTEE THE COMPLETENESS NOR ACCURACY THEREOF.

2 WORKING DAYS  
BEFORE YOU DIG

CALL TOLL FREE 800-362-2764

OHIO UTILITIES PROTECTION SERVICE

Accepted as shown and/or noted  
JAMES R. GILLS, P.E.  
County Drainage Engineer  
By A. S. Date 1/10/05