CHICAGO TITLE INSURANCE COMPANY COMMITMENT NO. 28330213 - SCHEDULE A:

P.O.R. - Title

Railroad Spike Found & Used

"X" Notch in Concrete

P.O.B. - Surveyor's Legal

Found & Used —

NOW OR FORMERLY: DMD REALTY, LLC

DOCUMENT #2004R036998 PARCEL #27Ã-001-00-055

(Use – Hotel)

P.O.C. - Surveyor's Legal

- 31.21' WIDD. & Used)

in Plat Volume 12, Page 833

5/8" Capped Rebar_ Found On-Line "LDC 5368"

NOW OR FORMERLY: LAGE ASSOCIATES — EAST, LLC

DOCUMENT #980058969

PARCEL #27A-001-00-025

(Use - Vacant)

"L.D.C. INC. 5368"

5/8" Capped Rebar Found

S61'50'44"W 3.38' from ---

comer "SHA 5108"

764.51

Situated in the City of Willoughby and City of Willoughby Hills, County of Lake, and State of Ohio: and known as being a part of original Willoughby Township Lot No. 3, Tract No. 6 and being bounded and

Beginning in the centerline of Hanna Road, now vacated 60 feet wide, at its intersection with the Southerly sideline of Maplegrove Road, width varies, said point lying South 1743'00" East along said centerline, a distance of 39.89 feet from a spike set at its intersection with the centerline of Maplegrove Road; Thence South 1713'00" East, along said centerline of Hanna Road, (now vacated), a distance of 380.81 feet to an iron pin set at an angle point therein; Thence South 23'06'00" East continuing along said centerline, a distance of 31.75 feet to an iron pin set at its intersection with the Northerly limited access line of Interstate Route 90: thence North 59'44'40" East. along said Northerly limited access line, passing an iron pin set at 30.24 feet, a total distance of 522.42 feet to an iron pin set at its intersection with said Southerly sideline of Maplegrove Road; Thence North 61'58'19" West along said Southerly sideline, a distance of 179.35 feet to an iron pin set at an angle point therein; Thence North 85°33'25" West along said Southerly sideline, a distance of 260.00 feet to an iron pin set an angle point therein; Thence North 78'30'14" West, continuing along said Southerly sideline, a distance of 130.30 feet to an iron pin set at an angle point therein at its intersection with the Easterly sideline of said Hanna Road, now yacated: Thence South 88'47'29" West, continuing along said Southerly sideline of Maplegrove Road, a distance of 31.21 feet to the place of beginning.

CHICAGO TITLE INSURANCE COMPANY COMMITMENT NO. 28330213 - SCHEDULE B. SECTION II:

Numbers correspond with Schedule B exception items contained in the above referenced Title Commitment.

1. Note: Premises under examination abut on Interstate Highway 90, a limited access interstate highway, to which vehicular access from abutting property is denied between regularly constituted access points. (MAY AFFECT THE SUBJECT PROPERTY - NO DOCUMENTS SPECIFIED / DOCUMENT NOT PROVIDED)

2. "INTENTIONALLY DELETED"

_"LDC 5368"

Building Setback

3 Story Brick Building 13,837 Sq. Ft.

`36' Height∴

(N 78°30'14" W 130 30'

9' Parking Encroachme

★764.13

764.70

3. Easement as contained in Instrument Recorded in Volume 495, Page 833 of Lake County Records. (AFFECTS THE SUBJECT PROPERTY - PLOTTED AND SHOWN HEREON)

★764.94

over Building Setback

4. The vacation Plat of Hanna Road as Recorded in Plat Volume 12, Page 40 shows the following: 'The vacated portion of Hanna Road is subject to a drainage, sanitary sewer, waterline and utility easement." (AFFECTS THE SUBJECT PROPERTY - PLOTTED AND SHOWN HEREON)

MISCELLANEOUS NOTES:

- 1. There is direct access to the subject property via Maplegrove Road, a public right—of—way. 2. The current zoning classification allows for the subject property to be used as a Hotel. 3. The locations of utilities shown on the survey are from visible evidence, markings by others and plans
- 4. The posted address on site is 35110 Maplegrove Road. 5. At the time of this survey there was no observable surface evidence of earth moving work, building construction or building additions within recent months. 6.At the time of this survey, there was no observable evidence of the subject property being used as a solid waste dump, sump or sanitary landfill.
- 7. At the time of this survey, there was no observable evidence of any recent changes in street right-of-way lines either completed or proposed, and available from the controlling jurisdiction. 8. At the time of this survey, there was no observable evidence of any recent street or sidewalk
- 9. The Property surveyed and shown hereon is the same property described in Schedule A of Chicago Title Commitment No. 28330213 with an effective date of February 21, 2008.

BASIS OF BEARING:

The meridian for all bearings shown hereon is the Westerly property line of subject property also being the centerline of former Hanna Road known as being South 1713'00" East per Lake County Record. **ENCROACHMENTS:** PARKING: 2' Parking Encroachment over Parking setback. 130 Parking Spaces 8' Parking Encroachment over Parking setback. 14' Parking Encroachment over Parking setback. 9' Parking Encroachment over Parking setback. 2' Building Encroachment over Building setback **FLOOD ZONE:** By scaled map location and graphic plotting only, the subject property appears to lie entirely in Zone C (Areas of minimal flooding) according to the Flood Insurance Rate Map for the County of Lake, Community Panel No. 3903220006A, Effective Date January 16, 1981. **ZONING:** Zoning Classification: G-B (General Business) Maplegrove Road Maximum Building Height: 60' Building Setbacks: Front=40', Side=10' (west property line), Side=40' (east Variable Width Public Right of Way property line), Regr=10' Parking Setbacks: Front=20', Side=5' (west property line), Side=15' (east property Parking Ratio: 1 Space per guest room or suite, plus 1 space per every 2 Note: Buildings with a height greater than 35' shall provide an additional 10' of side and rear yard setbacks for every 12' of building height greater than 35' 5/8" Capped Rebar (N 85°33'25" W 260.00' Dd. & Msd.) Zoning information provided by the City of Willoughby, phone: (440) 953-4207 Found & Used ±30.62' 764.90 over Parking Setback

Willoughby Tramz, LLC Deed Book 1059, Page 547 Parcel No. 27A-001-00-024 & 31A-012-00-005

Total Land Area:

City of Willoughby: ±97,220 Square Feet ±2.2319 Acres
Village of Willoughby Hills: ±21,324 Square Feet ±0.4895 Acres
Total Land Area: 118,544 Square Feet 2.7214 Acres

5/8" Capped Rebar Found & Used

CERTIFICATION:

This survey is made for the benefit of: Willoughby Tramz, LLC; Motel 6 Operating L.P., and Chicago Title Insurance Company

I, Timothy A. Finke, PS a Registered Land Surveyor do hereby certify to the aforesaid parties as of the date set forth that I have made a survey of a tract of land described as

Legal Description:

A certain parcel of land situated in the City of Willoughby and the Village of Willoughby Hills, County of Lake, State of Ohio. Known as being a part of the original Willoughby Township Lot No. 3, Treet No. 6. Known as being a portion of The Vacated Plat of Hanna Road, as recorded in Plat Volume 12, Page 833 of the Lake County Records. Known as being all of land now or formerly conveyed to Willoughby Tramz, LLC, as recorded in Deed Book 1059, Page 547 of the Lake County Records and being more particularly

COMMENCING at a railroad spike found at the intersection of the centerline of Maplegrove Road (Variable Width — Public) with the centerline of Hanna Road (60' Wide — Public) (Vacated per Plat Volume 12, Page 833);

Thence, South 1713'00" East along the centerline of said vacated Hanna Road, a distance of 39.89 feet to an "x—cut" found in concrete at the Northwest corner of land now or formerly conveyed to DMD Realty, LLC, as recorded in Document No. 2004R036998 of the Lake County Records, said point also being the POINT OF BEGINNING;

Thence, South 1773'00" East continuing along the centerline of said Hanna Road and the east line of said land of DMD Realty, LLC and also the east line of land now or formerly conveyed to LAGF Associates — East, LLC, as recorded in Document No. 980058969 of the Lake County Records, passing a 5/8" capped rebar stamped "LDC 5368" found at the Southeast corner of said land of DMD Realty, LLC, at a distance of 209.83 feet, for a total distance of 380.81 feet to a 5/8" capped rebar stamped "L.D.C. Inc. 5368" found at an angle point in the east line of said land of LAGS Associtates — East, LLC;

Thence, South 23'06'00' East continuing along said centerline and east line of said land of LAGF Associtates — East, LLC, a distance of 31.75 feet to a 5/8" capped rebar set at the Southeast corner of said land of LAGF Associates — East, LLC, reference a 5/8" capped rebar stamped "SHA 5108" found South 61'50'44" West from said corner, said

point also being on the North line of Interstate Highway 90 (Variable Width — Limited Access): Thence, North 59°44'40" East along the north line of said Interstate Highway 90, passing over the corporate division line between the City of Willoughby and the Village of

Willoughby Hills at an approximate distance of 284.47 feet, for a total distance of 522.42 feet to a 5/8" capped rebar stamped "6832" found on the south line of Thence, North 61°58'19" West along to south line of Maplegrove Road, a distance of 179.35 feet to a 5/8" capped rebar stamped "6832" found at an angle point;

Thence, North 85'33'25" West continuing along the south right of way line, passing over the corporate division line between the Village of Willoughby Hills and the City of Willoughby an approximate distance of 30.62 feet to a 5/8" capped rebar stamped "LDC 5368" found at an angle point:

Thence, North 78'30'14" West continuing along said south right of way line, a distance of 130.30 feet to a PK nail set at an angle point;

Thence, South 88'47'29" West continuing along said south right of way line, a distance of 31.21 feet to the POINT OF BEGINNING;

Containing 118,544 square feet (2.7214 acres) of land, more or less, approximately 97,220 square feet (2.2319 acres) of which lies within the City of Willoughby and approximately 21,324 square feet (0.4895 acres) of which lies within the Village of Willoughby Hills, as surveyed in February of 2008 by Timothy A. Finke, PS, Ohio Registered Professional Licensed Surveyor No. S-8392 for and on behalf of Millman Surveying, Inc. and is subject to all legal highways and easements of record.

The basis of all bearings shown hereon is the west line of the subject property known as being South 1713'00" East per Deed Book 1059, Page 547 of the Lake County Records.

The above described percel of land is all of the same land as described in Chicago Title Insurance Company Title Commitment No. 028330213, having an effective date of

All rebar set are 5/8 inch in diameter, 30 inches in length with a yellow, plastic stamped "MILLMAN 330-342-0723".

I further certify that:

1. The accompanying survey was made on the ground and correctly shows the location of all buildings, structures and other improvements situated on the above premises;

2. That there are no visible encroachments on the subject property or upon adjacent land abutting said property except as shown hereon;

3. That the title lines and the lines of actual possession are the same and the improvements erected on the property as shown hereon do not encroach over the property lines, lots lines, building lines, setback lines, title lines, government lease or patent lines or over any easement or rights of way;

4. All courses and distances and other measurements were established by actual field measures and the boundaries and monuments indicated hereon were actually located;

5. All utility services required for the operation of the property and the improvements thereon either enter the property through the adjoining public streets and/or the survey shows the point of entry and location of any utilities which pass through or are located on adjoining private land.

6. All applicable setback and sideyard lines are shown on the survey and there are no violations of any applicable zoning or subdivision ordinances;

7. This map or plat and the survey on which it is based were made (i) in accordance with the "minimum standard detail requirements for ALTA/ACSM Land Title Surveys," jointly established and adopted by ALTA, ACSM and NSPS in 2005, and includes item 1-4, 6, 7(a), 7(b), 8-10, 11(b) and 13, 14, 16-18 of table "a" thereof, and (ii) pursuant to the accuracy standards as adopted by ALTA, NSPS and ACSM in effect on the date of this certification, the undersigned further certifies that the positional uncertainties resulting from the survey measurements made on the survey do not exceed the allowable positional tolerance.

8. The property described hereon is the same property described in Chicago Title Insurance Company Commitment No. 28330213 dated February 21, 2008, and that all easements, covenants and restrictions referenced in said title commitment are apparent from a physical inspection of the site otherwise known to me have been plotted hereon or otherwise noted as to their effect on the subject property.

9. Said described property is located within an area having a zone designation C by the Federal Emergency Management Agency (FEMA), on flood insurance rate map no. 0006A, with a date of identification of January 16, 1981, for Community No. 390322, in the City of Willoughby and City of Willoughby Hills, State of Ohio, which is the current flood insurance map for the community in which the said premises is situated.


10. The property has direct access to Maplegrove Road, a dedicated public street

Field work completed February 29, 2008.

111

Ohio Professional Surveyor No. 8392 For and on behalf of killman Surveying, Inc. Date of Survey: February 29, 2008



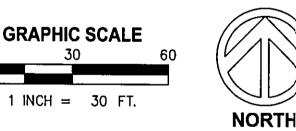

SYMBOL LEGEND

W	Right—of—Way		- Fire Hydrant
Ĺ	- Adjoiner Property Line	₩.	 Water Valve
; .B.	 Centerline 	👸	 Water Manhole
	- Place/Point of Beginning		- Sanitary Manhole
.R.	 Place/Point of Reference 	l <u>sa</u>	- Air Condition Unit
7	 Encroachment/Protrusion 		- Utility Pedestal (As Noted)
	 Schedule B-Section II Item 		- Electric Transformer
C.	 Calculated 	•	- Bollard Post
d. I	- Measured	હૈ	- Handicap Space

- Dd. - Finished Floor Elevation - Drainage Flow Direction
- Ground Shot Elevation (GS) Monumentation Found as Noted - Railroad Spike Found - 5/8" Rebar w/Cap Set
- "MILLMAN 330-342-0723" - P.K. Nail or Drill Hole Set
- Catch Basin Cleanout - Electric Meter
- No. of Regular Parking Spaces No. of Handicap Parking Spaces - Storm Manhole
- Gas Meter - Water Stand Pipe
- --- □ --- Fence (As Noted) -san- - Sanitary Sewer —stm— – Storm Sewer ──w─ - Water Line —e—— – Underground Electric
- ----g — - Underground Gas —ou— — Overhead Utilities - Concrete Area

- Sign

Wall (As Noted)

→ - Guy Wire

- Utility Pole

- Light Pole

- No Parking Area

- Building Area

ALTA/ACSM LAND TITLE SURVEY PREPARED FOR:



Accor North America 4001 International Parkway Carrollton, TX 75007


Phone: (972) 360-2716

Fairfield Inn 35110 Maplegrove Road City of Willoughby **County of Lake State of Ohio**

MILLMAN SURVEYING,
CORPORATE HEADQUARTERS:
Www.SUR
1742 Georgetown Road, Suite H
Phone: Drawn By: MRK Project Manager: DLH Date: February 29, 2008 Scale: 1"=30" Checked: TAF Sheet: 1 of 1 **REVISION NOTES**

Date: | Comment: 3/17/08 Utility Update, Legal Description, Zoning, Cert 3/21/08 | Legend Symbol—Iron to P.K. Nail 3/25/08 | Added gas line MK 4/03/08 Surveyor's Legal Description Added

National Commercial Division MSI Site No.: 13364

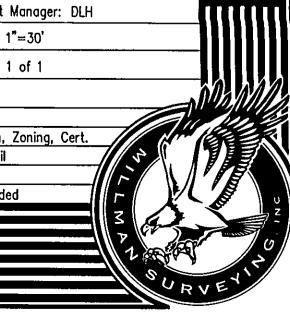

UTILITY INFORMATION SANITARY Lake County Water 105 Main St Painsville, OH 44077 (440) 350-2645 WATER Lake County Water 105 Main St (440) 350-2645 UNDERGROUND UTILITIES

NON-MEMBERS MUST BE CALLED DIRECTLY


(800) 589-3101 <u>TELEPHONE</u> SBC — AT&T 45 Erie View Plaza Painsville, OH 44077 Cleveland, OH 44114 (800) 288-2020 <u>GAS</u> Dominion BEFORE YOU DIG
CALL1-800-362-2764 (TOLL FREE)
TITY NOTIFICATION CENTER OF OUR
MBERS MUST RE Time Warner 1201 E 55th St 77 N St Clair St Cleveland, OH 44103-1028 Painsville, OH 44077 (800) 362-7557 (877) 772-2253

ELECTRIC Illuminating Company 76 South Main St

Akron, OH 44308

764.99

765.24

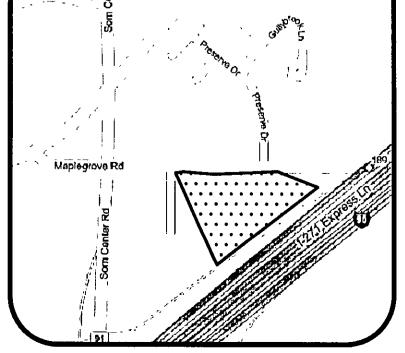

VICINITY MAP NOT TO SCALE